Technical Report Documentation Page

1. REPORT No.

2. GOVERNMENT ACCESSION No.

3. RECIPIENT'S CATALOG No.

4. TITLE AND SUBTITLE

Progress Report Of Test Results On Samples Taken From Seal Coat Test Sections Road 11-Imp-III P.M. 1.2-9.7

7. AUTHOR(S)

G. Kemp

5. REPORT DATE

July 1966

6. PERFORMING ORGANIZATION

8. PERFORMING ORGANIZATION REPORT No.

9. PERFORMING ORGANIZATION NAME AND ADDRESS

State of California Highway Transportation Agency Department of Public Works Division of Highways 10. WORK UNIT No.

11. CONTRACT OR GRANT No.

12. SPONSORING AGENCY NAME AND ADDRESS

13. TYPE OF REPORT & PERIOD COVERED

Progress Report

14. SPONSORING AGENCY CODE

15. SUPPLEMENTARY NOTES

16. ABSTRACT

District 11 Maintenance Department placed, during the month of May 1966, four seal coat experimental test sections at six locations on Road 11-IMP-III P.M. 1.2-9.7, where extensive raveling was occurring on a recently completed contract (11-039314). The test sections, as shown in the report, were placed in order to evaluate the relative merits of a "Reclamite" treatment when compared with an emulsion seal, and combination fuel oil-diesel oil treatment. At each location an untreated section of pavement was left as a control. In addition to sealing the pavement the "Reclamite" treatment and diesel-fuel oil combination may also be considered as asphalt softening agents.

The Materials and Research Department was asked to perform the laboratory testing of cores obtained prior to, and at intervals after treatment in order to evaluate the relative merits of the various applications. This report is prepared mainly for conveying the test results obtained on the cores taken from the pavement before treatment.

The test data shows there are differences in asphalt hardening, at the various test sections, and this hardening is more than expected for such a new pavement. Section 2 had the hardest and most viscous asphalt and Section 4 had the softest or least viscous asphalt before treatment. Differences in asphalt hardness appear to be caused by asphalt content, void content, and possibly the grade of asphalt used during construction. The two grades of asphalt used were 60-70 and 85-100 penetration paving asphalt.

The test section will not only be valuable for evaluating the effects of the treatment applied, but will serve in some degree for evaluating the rate of asphalt hardening with depth and void content.

17. KEYWORDS

18. No. OF PAGES: 19. DRI WEBSITE LINK

http://www.dot.ca.gov/hq/research/researchreports/1966-1967/66-05.pdf

20. FILE NAME


66-05.pdf

This page was created to provide searchable keywords and abstract text for older scanned research reports. November 2005, Division of Research and Innovation



STATE OF CALIFORNIA HIGHWAY TRANSPORTATION AGENCY DEPARTMENT OF PUBLIC WORKS DIVISION OF HIGHWAYS

PROGRESS REPORT OF TEST RESULTS
ON SAMPLES TAKEN FROM SEAL COAT TEST SECTIONS
ROAD II-Imp.-III

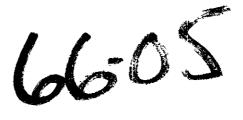

JULY 1966



State of California Department of Public Works Division of Highways Materials and Research Department

July 22, 1966

M&R Project 19301-762400-33290

Mr. J. Dekema District Engineer District 11 P.O. Box 390 San Diego, California

Dear Sir:

Submitted for your consideration is:

PROGRESS REPORT

OF

TEST RESULTS ON SAMPLES TAKEN FROM SEAL COAT

TEST SECTIONS ON ROAD

11-IMP-111 P.M. 1.2-9.7

. Pavement Section Study made by E. Zube Under general direction of ... E. Zube

Very truly yours,

OHN L. BEATON

Materials and Research Engineer

INDEX

2012	Page
SYNOPSIS	1
INTRODUCTION	2
CONCLUSIONS	3
TEST RESULTS AND DISCUSSIONS	4-5
Stability	
Cohesion	
Air Permeability and % Air Voids	
Extraction Results (% Asphalt)	
Recovered Asphalt Test Results	

SYNOPSIS

District 11 Maintenance Department placed, during the month of May 1966, four seal coat experimental test sections at six locations on Road 11-Imp-III P.M. 1.2-9.7, where extensive raveling was occurring on a recently completed contract (11-039314). The test sections, as shown in the report, were placed in order to evaluate the relative merits of a "Reclamite" treatment when compared with an emulsion seal, and combination fuel oil-diesel oil treatment. At each location an untreated section of pavement was left as a control. In addition to sealing the pavement the "Reclamite" treatment and diesel-fuel oil combination may also be considered as asphalt softening agents.

The Materials and Research Department was asked to perform the laboratory testing of cores obtained prior to, and at intervals after treatment in order to evaluate the relative merits of the various applications. This report is prepared mainly for conveying the test results obtained on the cores taken from the pavement before treatment.

The test data shows there are differences in asphalt hardening, at the various test sections, and this hardening is more than expected for such a new pavement. Section 2 had the hardest and most viscous asphalt and Section 4 had the softest or least viscous asphalt before treatment. Differences in asphalt hardness appear to be caused by asphalt content, void content, and possibly the grade of asphalt used during construction. The two grades of asphalt used were 60-70 and 85-100 penetration paving asphalt.

The test section will not only be valuable for evaluating the effects of the treatment applied, but will serve in some degree for evaluating the rate of asphalt hardening with depth and void content.

INTRODUCTION

In a teletype from Mr. P. E. Ruplinger to Mr. E. Zube, dated April 22, 1966, and in a memorandum dated May 12, 1966, from Mr. P. E. Ruplinger to Mr. J. C. Womack, District 11 requested the services of the Materials and Research Department to perform tests on cores obtained from their initiated seal coat experimental project.

The test sections involved are on road 11-Imp-III P.M. 1.2-9.7, from Calexico to 7 miles north. This newly constructed pavement was showing extensive "raveling" and "Reclamite" was advocated as a corrective treatment. The district set up six experimental test sections to evaluate the relative merits of three methods of treatment which are as follows:

- 1. "Reclamite" Seal (0.10 gal./sq.yd) 2 parts "Reclamite" with 1 part water.
- 2. Emulsion Seal (0.10 gal./sq.yd.) Mixing Emulsion (SS-1) cut back with 50% water.
- 3. Combination fuel oil and diesel fuel (0x75 gal./sq.yd) 2 parts A.P.I.20° fuel oil plus 1 part diesel fuel S.G. 0.84 at 60°F.

Each treatment was applied to a 100' long area (Fig I), covering all the southbound travel lane. A 100' long control section was left for comparison. The six test locations were located at post miles 2, 3, 4, 5, 6, and 7. According to the district, the remaining portion of pavement received "Reclamite" treatment applied at the rate of 0.1 gal./sq.yd.

Initial cores from the test sections were obtained on April 26, 1966 before any treatment was applied. Coring after treatment will be made some time in the spring of 1967 for evaluating the effect of the treatments applied.

The purpose of this report is to present the test results on the cores obtained prior to treatment.

CONCLUSIONS

Because this report was mainly prepared for reporting the test results of the cores taken before treatment, no conclusions can be made on the relative merits of the treatments applied. The test results obtained on the cores taken from the six test locations indicate that the asphalt varies in consistency between each location with Section 2 having the hardest asphalt with a penetration of 21, and Section 4 having the softest asphalt with a penetration of 45. "Raveling" should be more extensive at Sections 2 and 3 because of the hardness of the asphalt. Recoveries on the core slices showed that the asphalt was hardest at the surface and gradually softened toward the bottom of the core. Section 4 which had the softest asphalt and the least air voids and lowest air permeability, did not show this effect as much as the other two sections.

Air permeability test results follow the general trend of the air voids with the cores having the highest air voids showing the highest air permeability.

TEST RESULTS AND DISCUSSION

This discussion of the test results involves test data obtained on cores taken before any treatment was applied. The tests performed were stability, cohesion, air permeability, specific gravity (for calculating air voids), % asphalt, and tests on the recovered asphalt both from the whole core and individual 1/2" slices from top to bottom. Results of the various tests are shown in Tables A and B.

Stability
The stabilities obtained on cores from each test
location are low from a design standpoint. However, these are
typical of stabilities obtained from field cores where the
roadway has been under traffic for only a short period of time.
Stabilities generally increase as the density of the pavement
increases and approaches design density.

Cohesion
In general the cohesion results follow the pattern of the asphalt hardness with the highest cohesion obtained on the core from the section with the hardest asphalt and the lowest cohesion from the softest asphalt section.

Air Permeability and % Air Voids
The air permeability test results were quite
variable ranging from 39-500 Mls/min., and fall generally
in line with the percent of air voids. Asphalt hardening,
which appears to be quite rapid, was aggrevated by the high
void content and high permeability.

Extraction Results (%Asphalt)
There was a 1% difference between sections with the highest and lowest asphalt content. Section 4 had the highest asphalt content and the lowest % air voids with the lowest air permeability. Also the recovered asphalt was the softest from this section.

Recovered Asphalt Test Results
The recovered asphalt is considerably harder than
normal for such a newly placed pavement, (approximately 4
months old). The recovered asphalt from Sections 2 and 3 is
approaching a critical state with penetrations of 21 and 22 and
relatively low ductilities. Section 4 has the highest penerelation or the softest asphalt of all the sections tested and
tration or the with expected asphalt consistency. Job records,

(Contract 11-039314) show that two different grades were used on the project, 60-70 and 85-100 penetration paving asphalt. However, our records did not contain the job diaries, and it was, therefore, impossible to determine the exact location in the pavement where each grade was used. It is suspected that 85-100 grade was used at Section 4.

Asphalt hardness (viscosity in megapoise) in depth, as shown in Table B and Figure 2 for Sections 1 and 3, shows the hardest asphalt is near the surface with a gradual softening toward the bottom. Section 4 did not show this characteristic as much and had the softest asphalt of all the sections.

The other three sections (2, 5 and 6) were not tested for depth hardening because of high costs involved for this type of testing and the three sections tested were sufficient to show the general asphalt hardening trend.

TABLE A

CORE SAMPLE TEST RESULTS

	ed Aspn Method Duct.at	100+	13	26	100	75.	100+	i
	Recovered Aspn. Abson Method Pen.at Duct.at 77°F 77°F cm	1 72	21	22	45	28	35	ì
	% Asph.	4.7	4.6	4.2	5.2	4.6	4.8	
	Cohes. 140°F	130	150	147	85	110	06	
	Stab. 140°F	20	18	20	21	50	2.1	
	E _	11.9	10.7	11.4	7.0	10.2	8.2	
Test Sections	Theo. Max. Sp.Gr.	2.44	2.44	2.46	2.43	2.45	2.43	
	m Wax B Sp.Gr.	2.15	2.18	2.18	2.26	2.20	2.23	
, a d	Air Perm Mis/Min at 1" Vac	200	250	200	39	59	125	
	 	0.27	0.33	0.35	0.32	0.29 0.31 0.28	0.30	0.23
7061444	Road 11-1mp-111-1.2-7.0 Location Treatment Core in Planned Ht. Lane	Equision Control Fuel & Diesel Oil	Emilsion Control Fuel & Diesel Oil	Fuel & Diesel Oil	Equision Control Fuel & Diesel Gil	Emulsion Control Fuel & Diesel 011	Emulsion Control Fuel & Diesel Oil	Keclamile
•	Road 11-1mp Location in Lane	TWO TWO TWO	OWIT OWIT	OWI OWI	OWT OWT OWT	OWT OWT	TWO TWO TWO	IWO
	Lane	SB#2 SB#2 SB#2	SB#2 SB#2 SB#2 SB#2	SB#2 SB#2 SB#2 SB#2	SB#2 SB#2 SB#2 SB#2	SB#2 SB#2 SB#2 SB#2	SB#2 SB#2 SB#2	SB#2
	Station	1 1	497' South 11 F.H. 6.00 197' South 297' South 397' South	497' South 111 P.H. 5.00 197' South 297' South 397' South	497' South 197' South 297' South 397' South	497' South 197' South 297' South 397' South	497' South 197' South 297' South 397' South 397' South	497' South
	Samp Le No	Section 31083 31062 31071	31077 Section 31132 31063 31078	31084 Section 31082 31087	31074 Section 31076 31085 31081	31080 Section 31075 31088 31072	31069 Section 31079 31073	31068

TABLE B

CORE SAMPLE TEST RESULTS

Road 11-Imp-III-1.2-9.6 Seal Coat Test Sections Test Results on Recovered Asphalt

	ļ	Duct		_	_	ı.c.~	ارر		•		-			ဆ ဆ ဆ		ص ۾	102 85	2	
	3"	4	₹	7 27	9 27	7 25	3 2		0			11 11	╁	5.0			100 000	1	
	1 1 2	oise	8	22	20.	26.	25.	α,	55.		52	784		91		'n	<u>ه د</u>	2	
	2-1/2" -	Megapoise	5	14.2	14.2	16.2	$\frac{1}{15.5}$	7 16	23.0	' '	23.4	22.0	:	5.25	•	4.6	4.0 0.1	1	
	-	a 1	W.		10	13	18	,	٥٢	•	010	., r		92	3	96	71	2	
(SIIces)	2		.05 .001	21.0	58.0	30.7	34.7	1 (102.0	3	67.5	94.0	9:0	6.1	•	5.1	7.75	اة	
	1-7/8"	Viscosity Megapoise	5	۲,	23.4	·-	17.9 18.5	1	33. 9.0		σ.	34.0	}	4.85	٠		4· 6,		
Recovered Asphalt Test Results	3/4" 1	0	1 1		201		~ 6		r 0	0	'n	4,	٥	09	ر م	72	28	62	
r Test	- 1-3/4"	<u> </u>	-	ı c	63.0	1.0	85.0		108.0	N. CE.	0.06	104.0	109.2	6.2	6.2	7. 15.	6.5	6.26	
Sphal	1-1/4"	Viscosity	.05 .001	-	$\frac{27.2}{30.5}$	٣.	34.5	ţ	38.3	4	00		0	4.7	0		5.4	• 1	
ered 7	- - -	2	MA	Γ	 	7	- ∞ г	1	-1	Ľ	7	r 🗥	4	52	45	· ·	50	47	
Recov	1-1/8"				55.0		68.5	04.0	128.0	134.0	165.0	165.0	148.0	6.45	7.25	ŧ	٠,« درون	; ~	
	118/21	Viscosity	Megapoise	3	25.5 5 34.7 6		34.7	m]	0	50.5		49.5		9	5.7		4.0 7.7	5.54	
-		Micro	11		46			1	m	, ,		7 -	- 2		7.7		37	41	
	Top	ıГ	_	133	39.0) i	14.0	26.0	95.0	72.5 206.0		262.0	222.3	1.1 7	7.9		7.05	10.4 9.21	
		Viscosity	Megapoise	5	51.0 139.0) !	7.00 1.00 1.00	4.6		72.5		7.5	2.00	200	8.03 Lt./	1	6.65	7.04.0	
-		<u> </u>	Σ	+) <u>i1</u>	7				011	<u>د</u>		ليد		oi1	rte • te	
	Location Treatment	I			Emulsion	Control Fuel &	Diesel Oil 45.5 125.	Average		Emulsion	Fuel &	Diesel	Reclamite 69.0 220.3	WYEL GE	Emulsion	Fire &	Diesel	Reclamite 6.45 10.4	AVELABE
	tion T			-											E -1	E E	<u>.</u>	E	
	Loca	Lane			I.MO	300		- CMT	44	I S			IMO	-				Z OWT	_
	Lane				.00 SB/P2	SB#2	7 Jugo	SB#Z	00	SB#2		2Diff	SB#2	00.7	-1	SB#2		SB#2	
	ug Ug				M	297 South	367' south	497 South	P.M. 5.00	South	297 South	397'South	497'South	7 9	South	297'South	397 South	497' South	
	tati				1 P. M.	297	397		F	197	297	397							
	Sample Station				ᄖ		31071	31077	100			31070	31074		Section 31076	31085	31081	31080	
	Sa	<u>z</u> _			ky (<u>ი ი</u>	<u>ო</u> _	<u></u>			<u> </u>						_		

	100'	100	100'	100'
Outside Lane	Emulsion	No Treatment (control section)	2 pt. Fuel Oil I pt. Diesel	Reclamite

FIGURE |

ASPHALT VISCOSITY - CORE DEPTH RELATIONSHIP

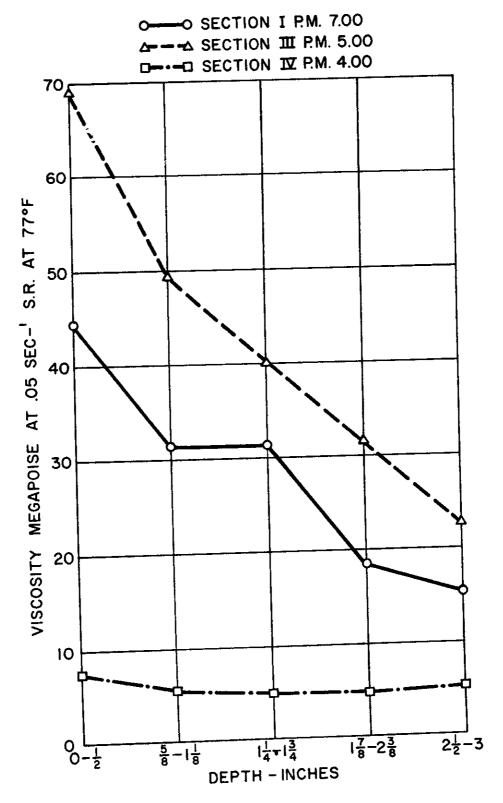


FIGURE 2